

Date: Friday, 21/11/2008 8:59:59 AM
 User: Julie Dawson

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: X-TUBE AS 350/355 HI AFT
Job Number	: 43681		
Estimate Number	: 13225		
P.O. Number	:	Part Number	: D350748241TRN
This Issue	: 21/11/2008	S.O. No.	:
Prsht Rev.	: NC	Drawing Number	: D350-748-241 REV.D
First Issue	: / /	Project Number	: N/A
Previous Run	: 43680	Drawing Revision	: D
	Type	Material	:
	: CROSSTUBES	Due Date	: 28/11/2008
Written By	:	Qty:	1 Um: Each
Checked & Approved By	: <u>JUD 08.11.21</u>		
Comment	: Est Rev:A New Issue 08-03-06 DD verified by:ec Est Rev B Removed polish 08.04.02 EC verified by : DD Est Rev C Removed LPS-3 08.06.23 Ec verified by: DD		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	D6018125	Crosstube Material
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
 Crosstube Material
 D6018-125
 2.299" OD X 2.000" ID
 Batch: B27472

am 08.12.02

2.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------

**Comment:** MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs on both ends as per Folio FA647

2-Turn first side as per Folio FA647

3- File transition lines smooth.

am 08.12.02

3.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------

**Comment:** INSPECT ALL DIM TO DIM SHEET

am 08.12.02

4.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------

**Comment:** MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA647

2- File transition lines smooth.

am 08.12.02

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 21/11/2008 8:59:59 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 43681

Part Number: D350748241TRN

Job Number:



Seq. #: Machine Or Operation: Description :

3-Scribe part # as per Dwg D350-748-241

Q.M 08.12.02 ①

5.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

Q.M 08.12.02 ①

6.0

QC8

SECOND CHECK



AWM 8-12-03



Comment: SECOND CHECK

7.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1 -



Comment: LARGE FABRICATION RESOURCE 1

Grind machining marks.

AWM 8-12-04

8.0

OUTSIDE SERV.11

OUTSIDE SERVICE -CROSSTUBES



Comment: Sub-Contracting OUTSIDE SERVICES

Issue P/O: 7849

C208112/16 ①

Heat Treat to min 180 KSI As per Dwg D350-748-241

Sand Blast tube after Heat Treat

Possible Supplier: Vac Aero

Ensure Certificate of Conformity is attached

9.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Receive & Inspect For Transit Damage

Ensure certificate of conformaty is attached

9/10/28 ①

10.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

8 09/01/29 ①

11.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and stock in kanban rack

Location: back Hall

MD 09-01-29

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 21/11/2008 8:59:59 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 43681

Part Number: D350748241TRN

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

QC21

FINAL INSPECTION/W/O RELEASE



09/02/02 *[Signature]*

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF
09-01-30

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: H3681
Description: Crosstube Assembly (AS350/355 High Aft)	Part Number: D350-748-241
Inspection Dwg: D350-748-241 Rev: D	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.245	/			
	2.180	+0.005/-0.000	2.185	/			
	2.180	+0.005/-0.000	2.185	/			
	2.208	+0.005/-0.000	2.214	/			
	2.234	+0.005/-0.000	2.239	/			
	2.253	+0.005/-0.000	2.258	/			
	2.272	+0.005/-0.000	2.273	/			
	2.299	+0.005/-0.000	2.299	/			
	0.063	+/-0.010	0.063	/			
	4.26	+/-0.030	4.26	/			
	R0.063	+/-0.010	R0.063	/			
	R0.50	+/-0.030	R0.50	/			
SIDE B	2.240	+0.005/-0.000	2.245	/			
	2.180	+0.005/-0.000	2.185	/			
	2.180	+0.005/-0.000	2.185	/			
	2.208	+0.005/-0.000	2.211	/			
	2.234	+0.005/-0.000	2.239	/			
	2.253	+0.005/-0.000	2.258	/			
	2.272	+0.005/-0.000	2.273	/			
	2.299	+0.005/-0.000	2.299	/			
	0.063	+/-0.010	0.063	/			
	4.26	+/-0.030	4.26	/			
	R0.063	+/-0.010	R0.063	/			
	R0.50	+/-0.030	R0.50	/			
	122.70	+/-0.060	122.750	/			

Measured by: a m	Audited by: AWH	Prototype Approval:	N/A
Date: 08.12.02	Date: 8-12-03	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	07.01.17	New Issue (P/O D350-748-201)	KJ/JLM	

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>qp</i>	DRAWN BY <i>qp</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>///</i>	APPROVED <i>///</i>	DRAWING NO. D350-748-241	REV. D SHEET 1 OF 3
DATE 06.10.31		TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE NTS
A	06.03.31	NEW ISSUE	
B	06.06.30	ADD D6018-125 & PRIME AND PAINT	
C	06.08.14	ADD CAD PLATING	
D	06.10.31	MAG. PARTICLE AND CAD PLATE AS MFD.	

RELEASED

06.10.31 *///*

QTY	P/N	DESCRIPTION
X	D350-748-241	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
1	D6018-125	CROSSTUBE (OR D6015-125)
2	D3502-1	SUPPORT
2	D2856-400-710	ABRASION STRIP
1	AELS-1032-225	INSERT
1	AN960JD10	WASHER
2	MS21920-20	CLAMP (PER DART SPEC. M-MS21920-20)
1	MS27039-1-10	SCREW

D350-748-141 CROSSTUBE:

- 1) MATERIAL: MANUFACTURED FROM D6018-125 OR D6015-125
FINISHED LENGTH = 122.70±0.06
- 2) MACHINE PER MACHINING DETAIL ON PAGE 3. BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITIONS SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 3) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS COPY
- 4) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D. ENGINEERING
- 5) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6736 OR AMS 2759-1C AFTER TURNING UNCONTROLLED COPY
- 6) FINISH: MAGNETIC PARTICLE INSPECT PER DART QSI 038 4.2
CADIUM PLATE PER AMS-QQ-P-416B, CLASS 1, TYPE II
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2 SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 13681
- 7) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.
- 8) INSTALL D2856-400-710 ABRASION STRIP WITH A GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D3502-1 SUPPORT, PER QSI 035.
- 9) TORQUE MS21920-20 CLAMPS 60 TO 80 IN-LB
- 10) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 11) ALL DIMENSIONS ARE IN INCHES
- 12) PART IS SYMMETRIC ABOUT CENTERLINE EXCEPT FOR Ø0.297 HOLE.

UNDER REVIEW
07.02.16 *///*
CUT FROM REDUCED
07.07.22

Copyright © 2006 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____



NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

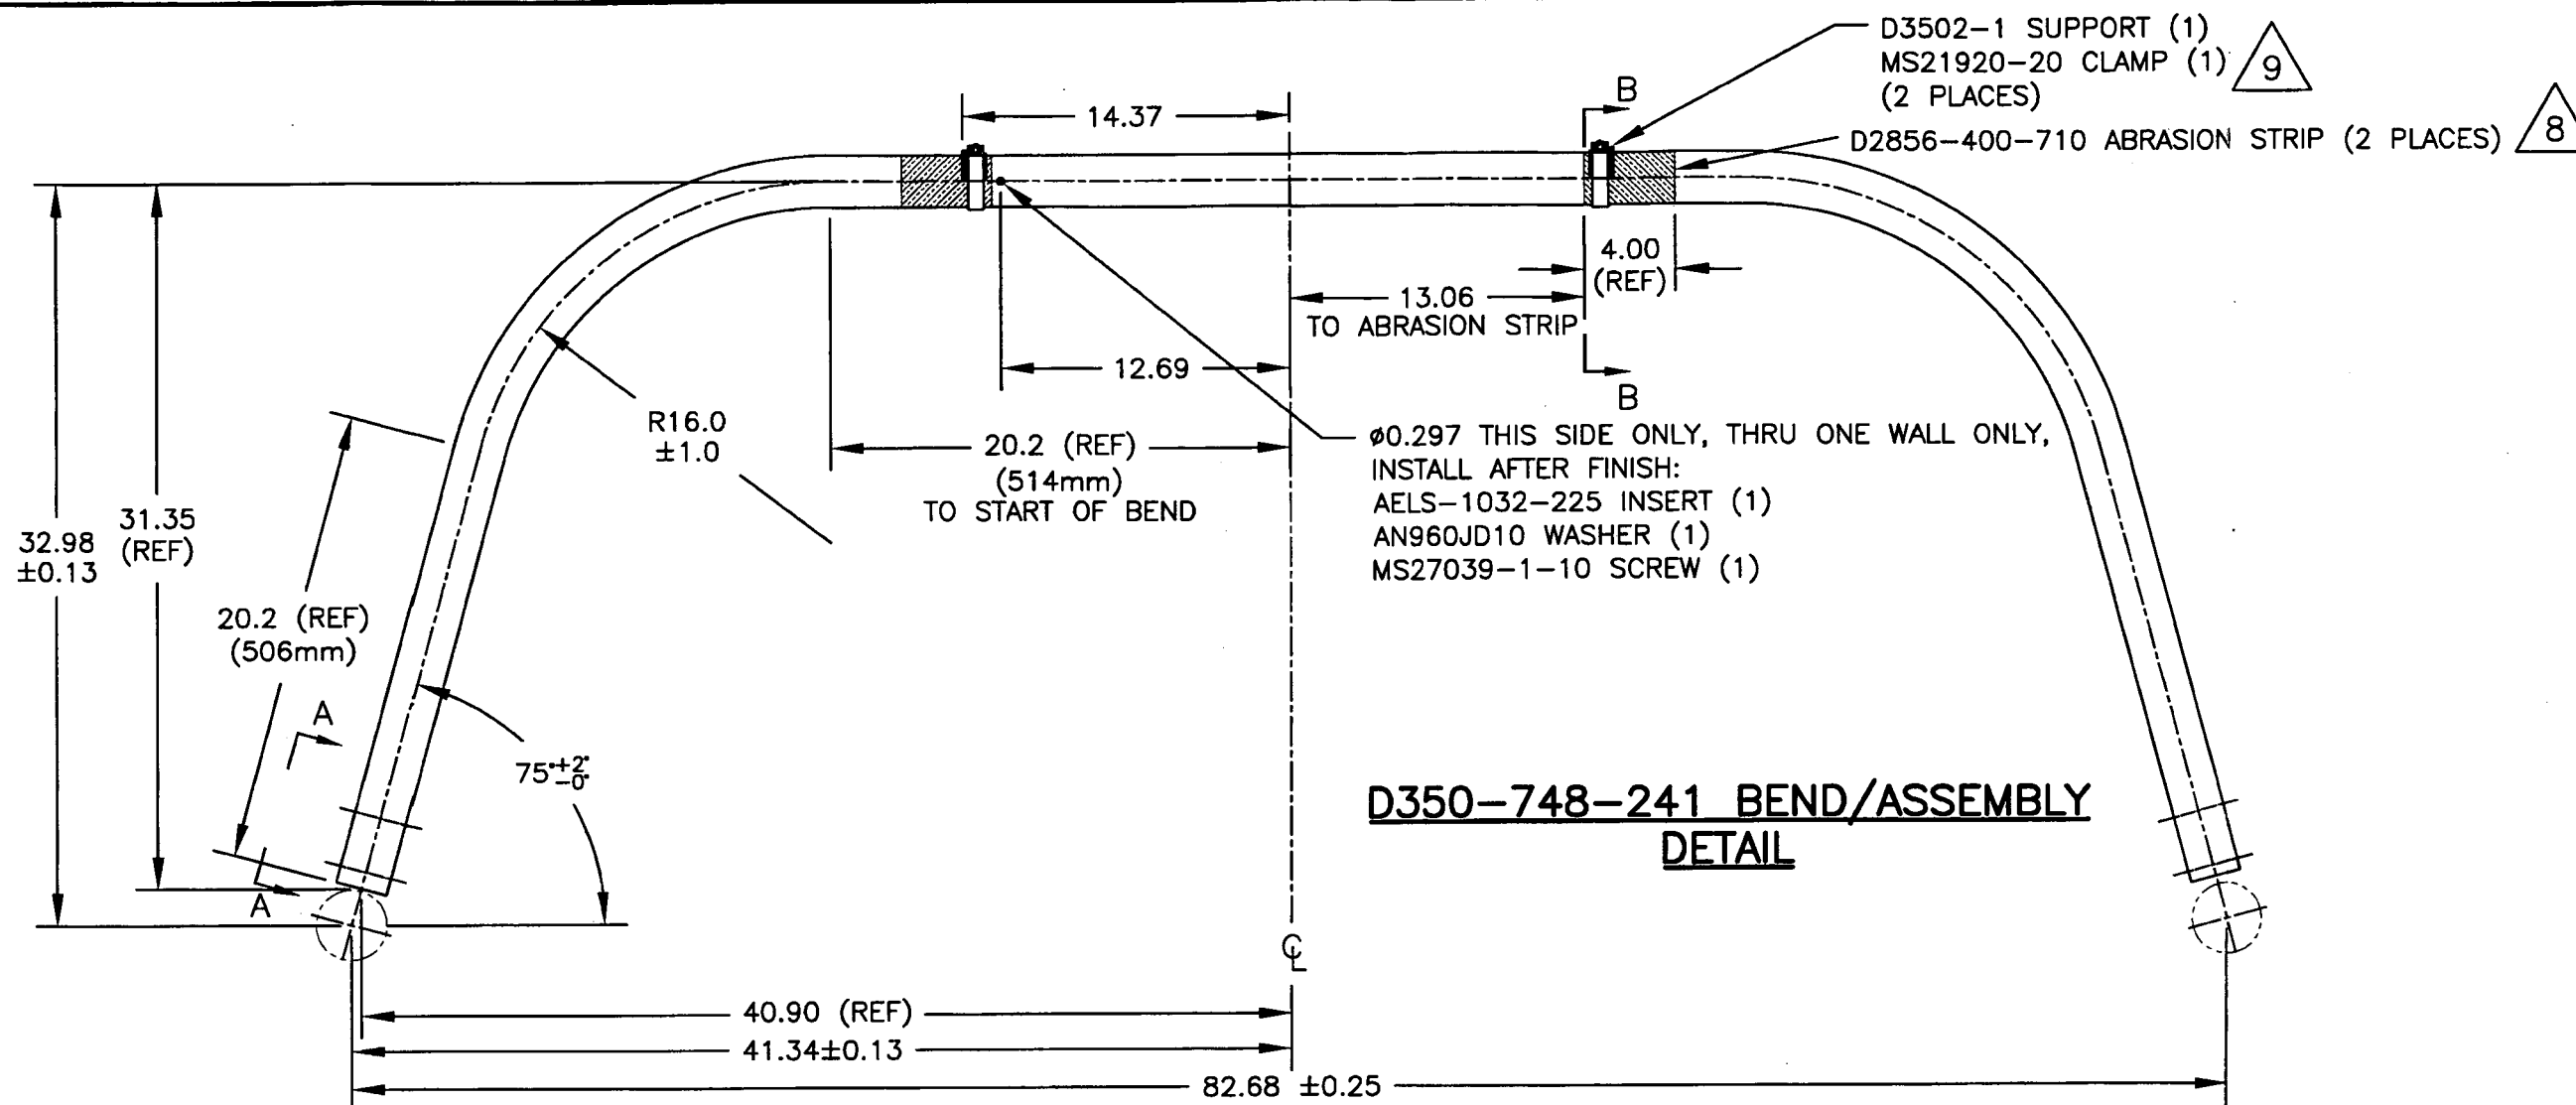

D350-748-241 BEND/ASSEMBLY DETAIL

SECTION B-B SCALE 1:2

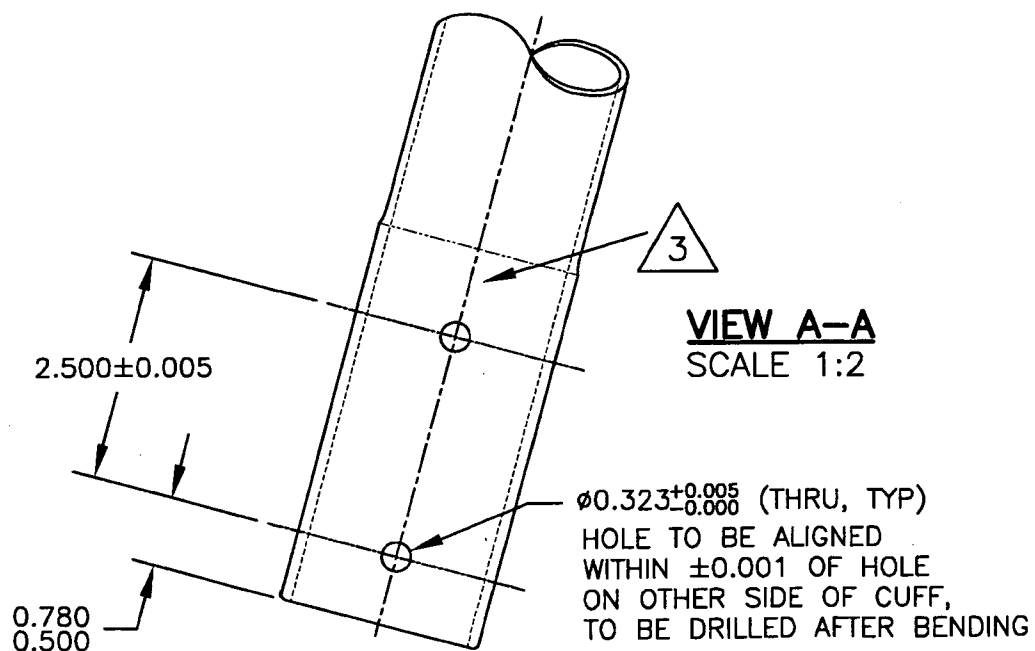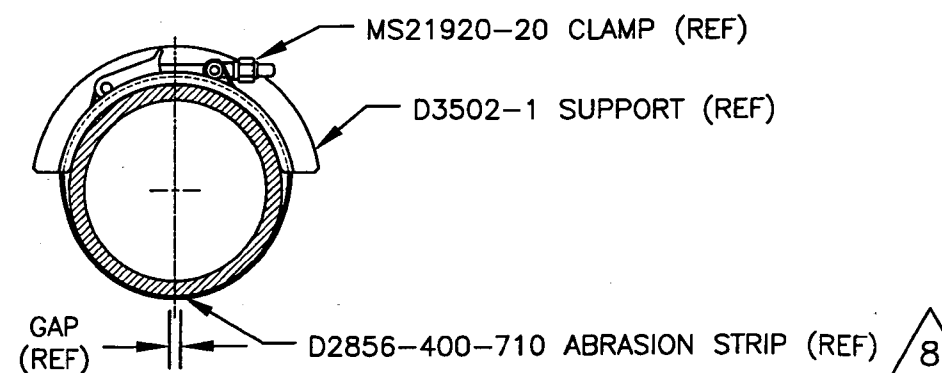

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 43681

UNDER REVIEW

07.02/16/11
CUFF JAW REDUCED
OK 07.11.22

RELEASED

06.10.31

COPYRIGHT © 2006 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN

90

DRAWN BY

90

DART

DART AEROSPACE LTD.
HAWKESBURY, ONTARIO, CANADA

CHECKED

11

APPROVED

11

DRAWING NO.
D350-748-241

REV. D
SHEET 2 OF 3

DATE


06.10.31

TITLE

CROSSTUBE (AS 350/355 HI AFT)



SCALE

1:8

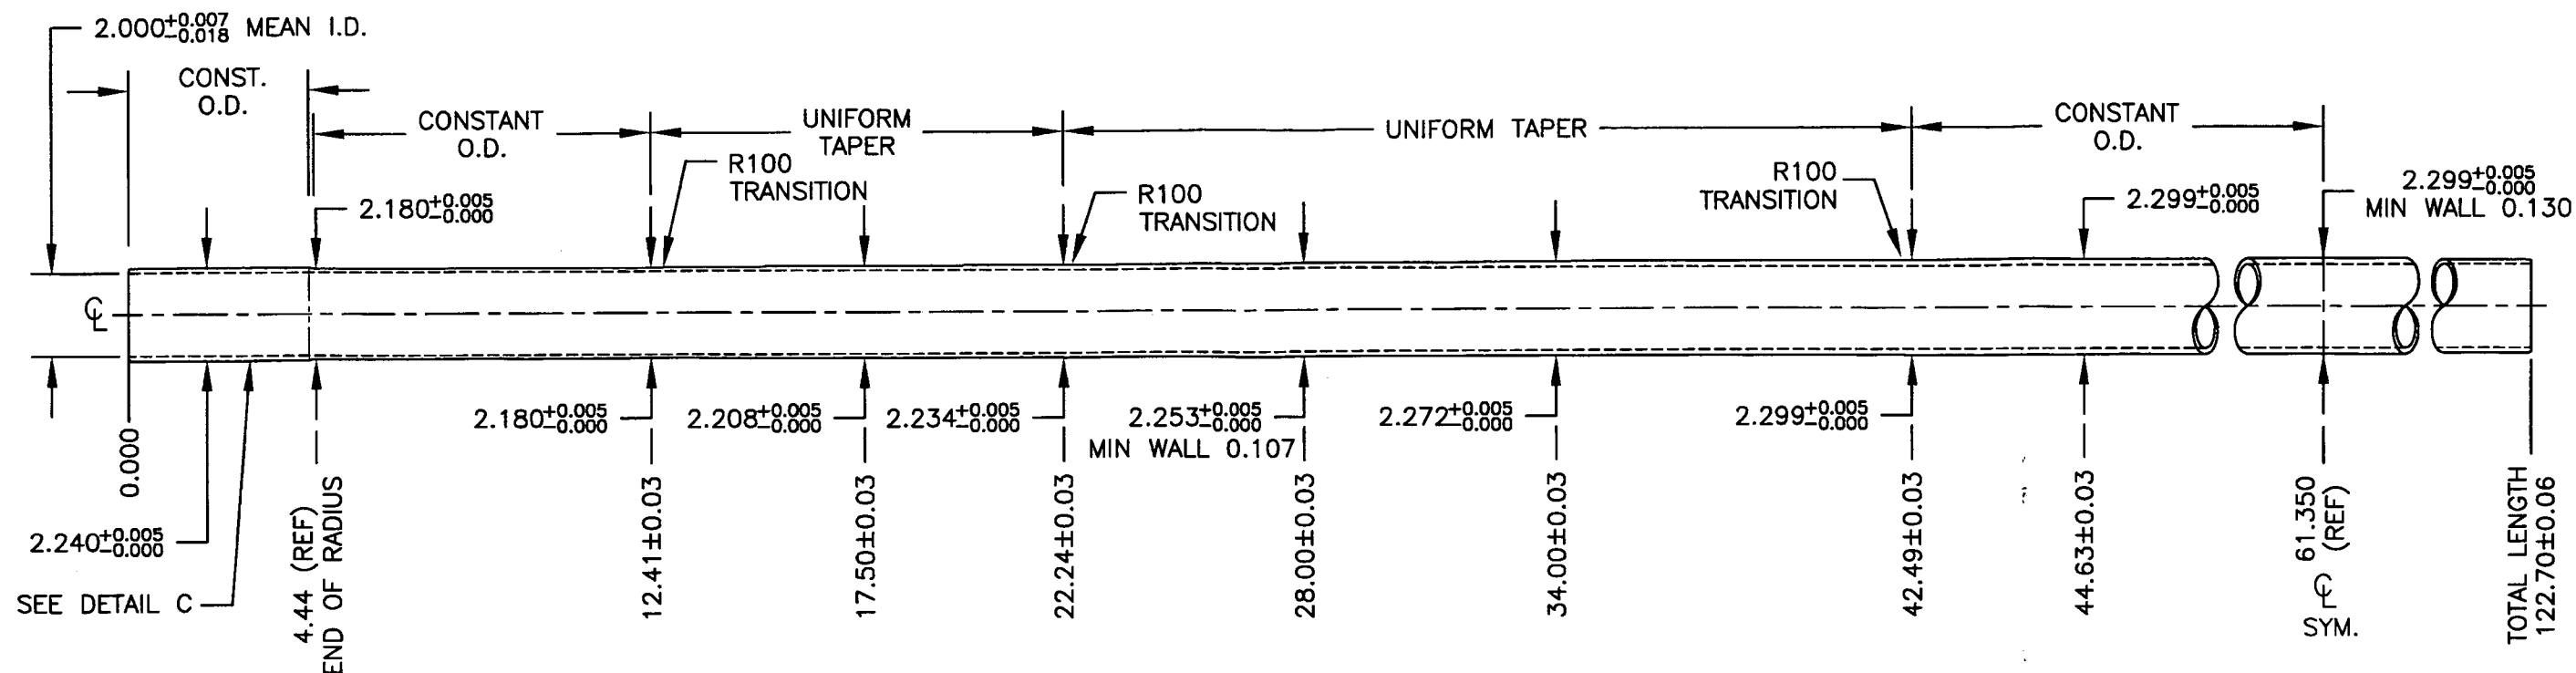

D350-748-241 MACHINING DETAIL

DETAIL C: CUFF
SCALE 1:1

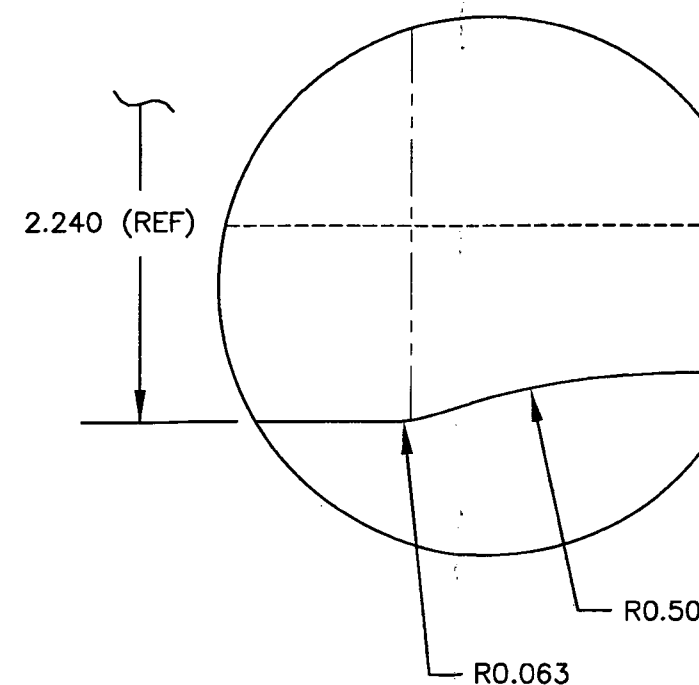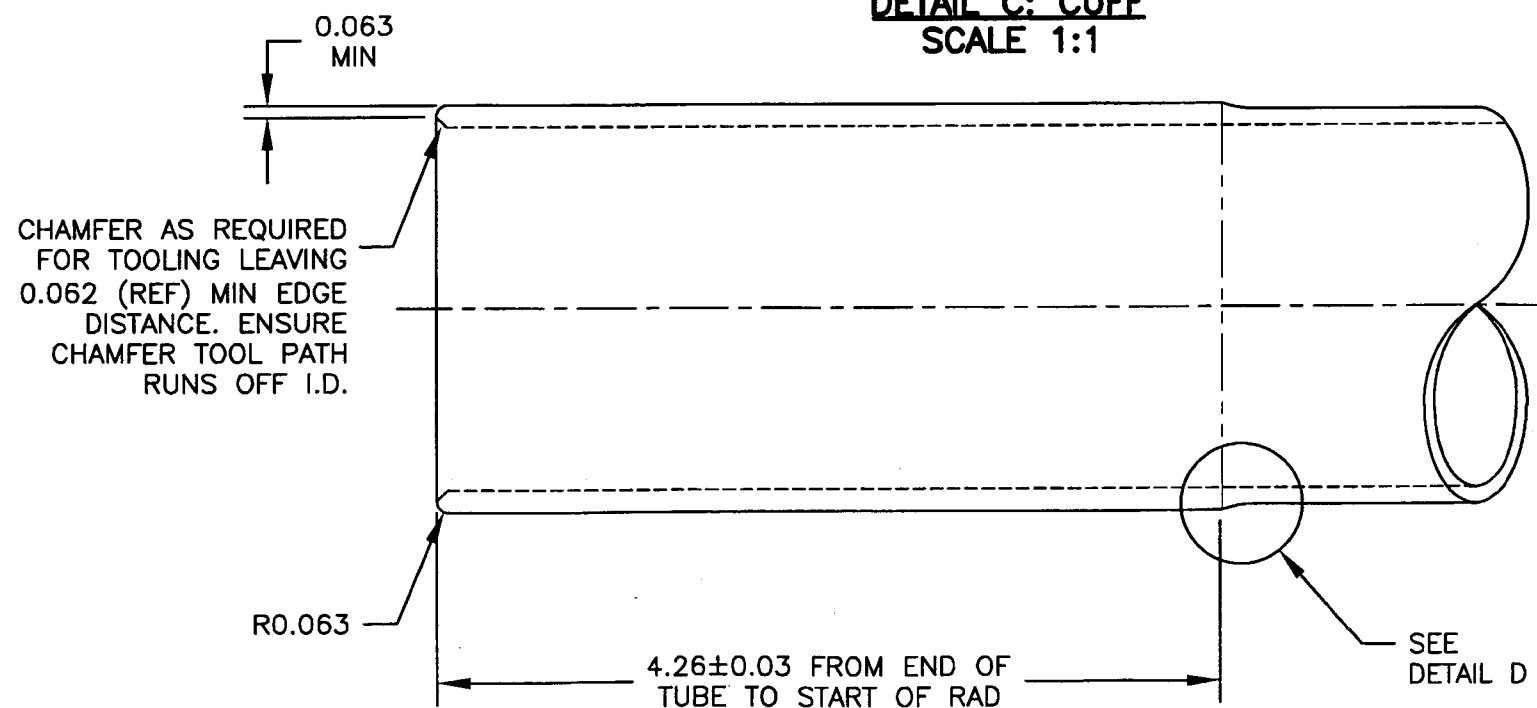

UNDER REVIEW

07.02/16
CUFF FOR REDUCED
06.07.11.22

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 43681

**DETAIL D:
CUFF TRANSITION**
SCALE 9:1

RELEASED

06.10.31

COPYRIGHT © 2006 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN qp	DRAWN BY qp	DART	DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. D350-748-241	REV. D SHEET 3 OF 3
DATE 06.10.31	TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE 1:4	



VAC AERO
INTERNATIONAL INC.

RELEASE NOTE

GST No. : R105468102

OAK 105611-1

☒ HEAD OFFICE
1371 SPEERS ROAD, OAKVILLE, ONTARIO
CANADA L6L 2X5
TEL: (905) 827-4171 FAX: (905) 827-7489

☐ 2009 WYECROFT ROAD, UNIT B
OAKVILLE, ONTARIO
CANADA L6L 6J4
TEL: (905) 827-7377 FAX: (905) 827-1380

☐ QUEBEC DIVISION
7450 RUE VÉRITÉ STREET, ST. LAURENT, QUÉBEC
CANADA H4S 1C5
TEL: (514) 334-4240 FAX: (514) 334-6269

01/26/2009

MM / DD / YYYY

PAGE : 1

BILL TO: 1DAR01
DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON

SHIP TO: DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON

K6A 1K7

K6A 1K7

DATE SHIPPED	SHIP VIA	F.O.B.
01/26/2009		ORIGIN
CUSTOMER P/O No.	JOB No.	TERMS
7849		NET 30 DAYS

PART No.	DESCRIPTION	UOM	QTY ORD	QTY SHPD	TEST RESULTS
----------	-------------	-----	------------	-------------	--------------

D350-748

-141

EA

12

12

Process Specifications: Procedure: 4353

HEAT TREATED TO 180 KSI MIN. PER AMS 2759-1D

100% HARDNESS CHECKED AS PER ASTM E-18

40/45 HRC

MATERIAL: 4130

D350-748-141-B43674, B43675, B43676, B43677, 4 PCS

D350-748-241-B43670, B43671, B43672, B43673,
B43678, B43679, B43680, B43681, 8 PCS

100% HARDNESS TESTED

12 pcs.

42/43 HRC

V.A.I.O.
TH.
25
Q.C.

S
04/01/09

* Parts were not sand blasted *

I hereby certify that the material covered by this release note has been inspected and tested and conforms to all specifications relevant there to in accordance with the conditions of the contract / or purchase order.

ON BEHALF OF VAC AERO INTERNATIONAL INC.

Shana Robinson
Authorized Q.C. Inspector

V.A.I.O.
TH.
25
Q.C.



VACUUM BRAZING - HEAT TREATING - SPECIAL PROCESSING - FURNACE EQUIPMENT
TURBINE COMPONENT OVERHAUL - PLASMA AND OTHER COATINGS

